

Gonesse, le 18/04/2017

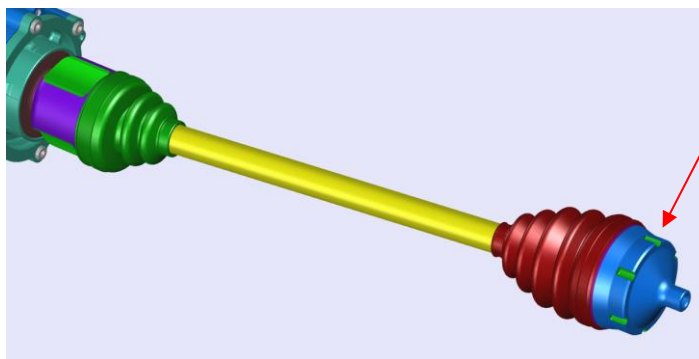
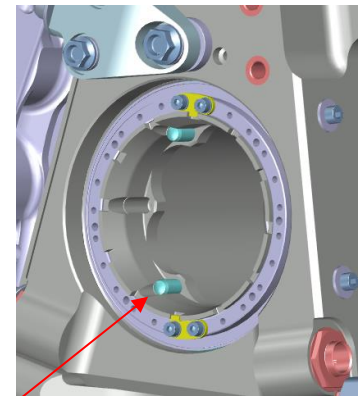
INFOTECH R5 - 17-02

Sujet : Précaution d'assemblage transmission latérale/pivot

Chers clients,

Lors de chaque montage d'une transmission sur un pivot/porte-moyeu (et plus particulièrement quand ces pièces sont neuves), nous vous invitons à contrôler que l'extrémité de la transmission est bien complètement emmanchée sur les centreurs du moyeu.

L'ajustement serré de cet assemblage peut en effet laisser penser que la transmission est correctement positionnée alors qu'elle ne porte en réalité pas sur toute la longueur du centreur.

Encoche
(notch)Centreur (pin)
ref 1E1318147A**Subject: drive shaft assembly**

Dear customers,

When assembling a drive shaft on the upright (especially when new), please make sure the drive shaft is fully engaged on the pins of the upright.

The clearance between these two parts is so tight that sometimes you can think it is properly fitted whereas the pins are not fully supported.

L'équipe des attachés techniques (Technical support staff)

Yann CHALMETON

yann.chalmeton@mpsa.com

Téléphone : +33 1 61 31 03 06

Mobile : +33 6 31 83 00 89

Benjamin GAUCHET

benjamin.gauchet@ext.mpsa.com

Mobile : +33 6 69 69 66 30

Christophe VELY

christophe.vely@mpsa.com

Téléphone : +33 1 61 31 03 98

Mobile : +33 7 61 51 37 92